


## **Basic Specifications**

**Dimensions :** 

Capacity		60Ah@0.2C Discharge
Voltage		3.2V
Standard charge current		0.20
Rapid charge current		0.5C
Standard Charging		0.2C CC(constant current) charge to
method		3.65V, then CV(constant voltage 3.65V)
		charge till charge current decline to $\leq 0.05$ C
Charging time		Standard charge: 5 hours (Ref.)
		Rapid charge: 2 hours (Ref.)
Max. charge current(safe)		1C
Max. discharge current(safe)		1.5C(100A)
Max.charge/discharge		5C (10S)
pulse current (10s)		
Discharge cut-off voltage		2.0V±0.15V
Charge voltage		DC 3.65V
Cycle life(0.2C discharge)		≥ 2000 cycles( 80%DOD)
Initial Impedance		<u>≤</u> 1mΩ
Battery Weight		Approx.1.50Kg
Working	Charging	0°C ~ +45°C
	Discharging	-20°C ~ +55°C
Storage Temperature		-10°C ~ +45°C
Dimension	Thickness	18±0.5mm
	Width	230±2 mm
	Length	250±2 mm



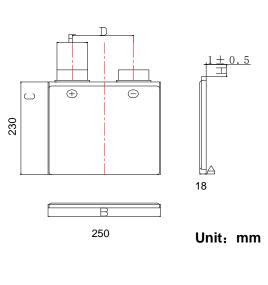

## Notice for Assembling Battery Pack

• Tab connection

Ultrasonic welding or spot welding is recommended to connect battery with PCM or other parts. If apply manual solder method to connect tab with PCM below notice is very important to ensure battery performance.

- 1) The solder iron should be temperature controlled and ESD safe.
- 2) Soldering temperature should not exceed  $350^{\circ}$ C.
- 3) Soldering time should not be longer than 3s.
- 4) Soldering times should not exceed 5 times.
- 5) Keep battery tab cold down before next time soldering.
- 6) Directly heat cell body is strictly prohibited Battery maybe damaged by heat above approx  $100^{\circ}$ C.

## • Cell fixing

- 1) The battery should be fixed to the battery pack by its large surface area.
- 2) No cell movement in the battery pack should be allowed.

Manufacturer reserves the right to alter or amend the approval sheet without the prior notice